


BRAKE SHOE CORE

IDENTIFICATION CHART



SEPT 2019

**Damage Shown Indicates
An Unacceptable Core**

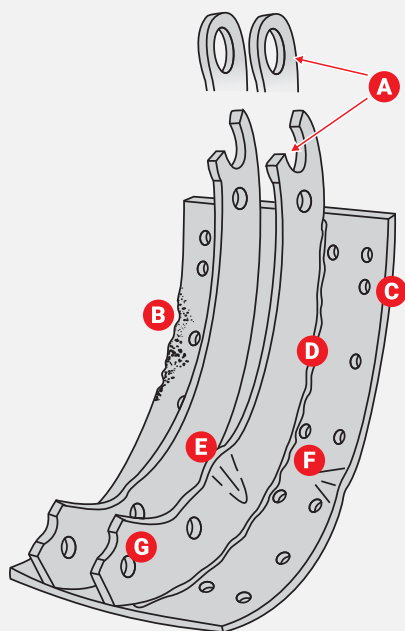

- A** Elongated Anchor Pin Slots/Holes
- B** Severely Corroded Table
- C** Elongated Rivet Holes
- D** Broken Welds
- E** Deformed Web
- F** Bent Table
- G** Flattened Roller

12 1/4" DIAMETER

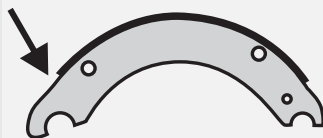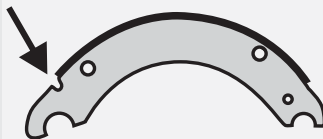

Dana/Std. Forge

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-5303A	7 1/2"	4692	E3782

Dana/Std. Forge

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-10763	7 1/2"	4692	E10757 (Early Ver.) E10756 (Later Ver.)



Std. Forge

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-2393	5 1/2"	4536	E2402HD E2403HD
XE-2394	7 1/2"	4591	E2402HD E2403HD

Dexter

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-10876	4"	4700	E10875
XE-10878	7 1/2"	4591	E10875

15" DIAMETER

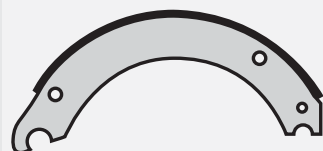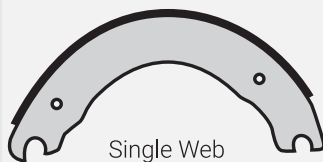

Rockwell "Q"

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-5528	4"	1308TT	E1308QMA

Eaton

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-5126	4"	1308TT	E1308E

Eaton "ES"

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-9027	4"	1443TT	E1308E

Rockwell "Q Plus"

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-9062	4"	4702	E9064
XE-11453	5"	4703	E9064
XE-11456	8 5/8"	4710	E9064



CBS PARTS LTD.

ABBOTSFORD (604) 859-6731
CHILLIWACK (604) 800-9119
DELTA (604) 589-7277
KAMLOOPS (250) 314-1000

PRINCE GEORGE (250) 563-9330
SURREY (604) 888-1944
Website cbsparts.ca
Online Ordering cbspartsnet.ca

BRAKE SHOE CORE

IDENTIFICATION CHART

SEPT 2019

Identifying a Rockwell "Q" vs. "Q Plus" Shoe

1. Is there a hump on the web?

YES: This is a "Q" Shoe

NO: Go to Question 2

2. Is there a "+" marked on the underside of the table?

YES: This is a "Q Plus" Shoe




NO: Go to Question 3

3. Measure the rivet edge to the edge of the shoe on the underside of the table:

5/8": This is a "Q" Shoe

1/2": This is a "Q Plus" Shoe

16½" DIAMETER

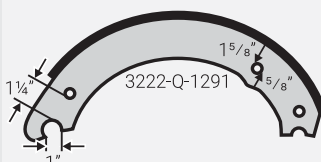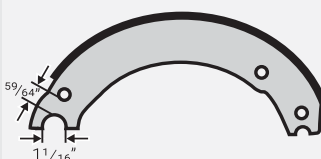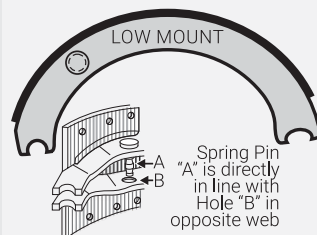

Eaton

CBS Shoe No.	Width	FMSI No.	Hardware Kit
1800 Series	7"	4311J	E4311EHD

Eaton "ES"

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-10270	5"	4719	E10760
XE-10271	6"	4725	E10760
XE-10272	7"	4709	E4709ES2N
XE-10273	8 ⁵ / ₈ "	4726	E4709ES2N

Freuhau "XEM 3"

CBS Shoe No.	Width	FMSI No.	Hardware Kit
1500 Series	7"	4515E	E4515UHDC E4515XHDC

Rockwell "Q" Special

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-3823 Mack Special	5"	4524B	E9644 "Suitcase Handle" Return Spring
XE-9780 Mack Special	6"	4514G	E9644 "Suitcase Handle" Return Spring

Rockwell "Q"

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-3303 ("Q")	5"	XE-3303	E4515UHDC*
XE-3304 ("Q")	6"	4514G	E4515UHDC*
1200 Series ("Q")	7"	4515G	E4515UHDC*
XE-3522 ("Q")	8 ⁵ / ₈ "	4551B	E4515UHDC*

Rockwell "Q Plus"

CBS Shoe No.	Width	FMSI No.	Hardware Kit
XE-10854 ("Q+")	5"	4720	E9644
XE-10847 ("Q+")	6"	4715	E9644
XE-5503 ("Q+")	7"	4707	E4515UHDC*
XE-10850 ("Q+")	8"	4718	E4515UHDC*
XE-10844 ("Q+")	8 ⁵ / ₈ "	4711	E4515UHDC*

*the E4515UHDC short kit can be replaced with E4515QHDC long kit



CBS PARTS LTD.

ABBOTSFORD (604) 859-6731
CHILLIWACK (604) 800-9119
DELTA (604) 589-7277
KAMLOOPS (250) 314-1000

PRINCE GEORGE (250) 563-9330
SURREY (604) 888-1944
Website cbsparts.ca
Online Ordering cbspartsnet.ca